

NUMBER:

DATE:

17-06-01R

05/11/05

SERVICE BULLETIN

APPLICABILITY: 1995MY and after Legacy

1998MY and after Forester 1993MY and after Impreza 2003MY and after Baja

SUBJECT: Seat Belt Latch Slides to the Lower Seat Belt Anchor

DESCRIPTION

In the event you encounter a customer complaint of the seat belt latch sliding down the webbing to the lower seat belt anchor, it may be caused by the latch web stop button separating from the belt webbing. This stop button may become loose and fall off if the belt webbing is jammed between the body panel and door when the door is closed.

Use the chart below to locate and order the correct repair kit for your application.

Button Kit	Button Color		
64780AC500EW	Beige		
	(use with		
	Beige Belt)		
64780AC500VB	Black		
	(use with		
	Black Belt)		

REPAIR PROCEDURES

- 1) Inspect the belt webbing for damage. If damaged replace the seat belt assembly.
- 2) Remove any piece of broken stopper button from the belt webbing.
- 3) Lift the belt latch up and beyond the original stopper button location and hold in place using adhesive tape.
- 4) Locate the original stopper hole (about 500mm up from bottom anchor) in the webbing and insert the new male stopper button from the backside of the belt. Push the other part of the button over the pin sticking through the front belt webbing.
- 5) Using a suitable tool, crimp the two parts together until the new button thickness is 4.5~5.0mm.
- 6) Remove the adhesive tape from the latch and confirm the stopper button holds the latch in the proper position.

continued...



CAUTION: VEHICLE SERVICING PERFORMED BY UNTRAINED PERSONS COULD RESULT IN SERIOUS INJURY TO THOSE PERSONS OR TO OTHERS.

Subaru Service Bulletins are intended for use by professional technicians ONLY. They are written to inform those technicians of conditions that may occur in some vehicles, or to provide information that could assist in the proper servicing of the vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do the job correctly and safely. If a condition is described, DO NOT assume that this Service Bulletin applies to your vehicle, or that your vehicle will have that condition.

Number: 17-06-01R; Date 05/11/2005 Page 2

For vehicles within the Basic New Car Limited Warranty period, this repair can be claimed using:

Item Description/Fail Code	Operation Number	Labor Description	Flat Rate Time
Front seat belt stopper button YEF-01, 02, 05, 08	A913-722	Front seat belt stopper button R&R	One or Both sides 0.2