

5. Spark Plug Cord

A: INSPECTION


1. 2200 cc MODEL

Check for:

- 1) Damage to cords, deformation, burning or rust formation of terminals
- 2) Resistance values of cords

Resistance value:

5.12 — 12.34 kΩ

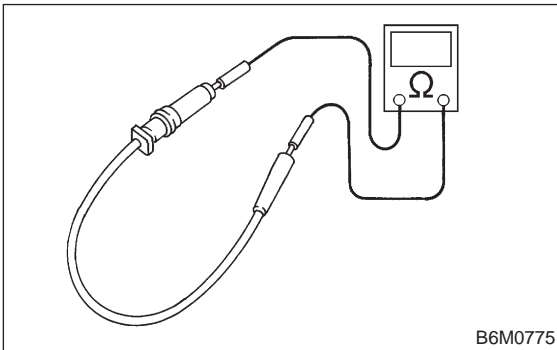

2. 2500 cc MODEL


Check for:

- 1) Damage to cords, deformation, burning or rust formation of terminals
- 2) Resistance values of cords

Resistance value:

#1 and #3

6.43 — 15.01 kΩ

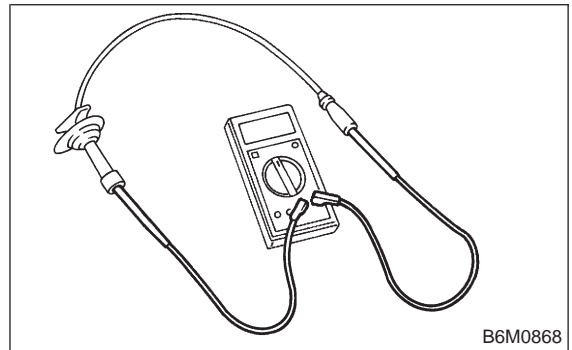

#2 and #4

6.67 — 15.57 kΩ

