

2. Horn System

A: WIRING DIAGRAM


1. HORN

<Ref. to WI-143, WIRING DIAGRAM, Horn System.>

B: INSPECTION

1. HORN RELAY

Measure the security horn relay resistance between terminals (indicated in the table below) when connecting terminal No. 4 to battery positive terminal and terminal No. 3 to battery ground terminal.

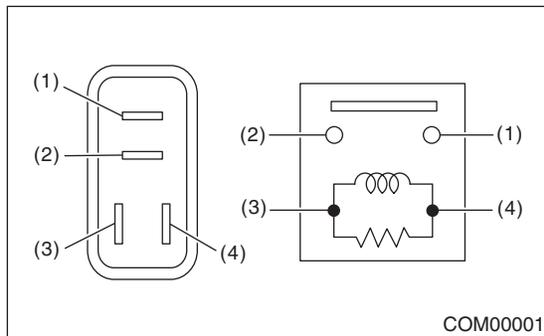

| Continuity | Terminal No. | Standard |
|------------|--------------|--------------|
| Yes | 1 and 2 | Less than 1Ω |
| No | | 1 MΩ or more |