

**ATTENTION:**

GENERAL MANAGER  PARTS MANAGER   
 CLAIMS PERSONNEL  SERVICE MANAGER

*IMPORTANT - All Service Personnel Should Read and Initial*


**SUBARU** 

**SERVICE BULLETIN**

**APPLICABILITY:** 2000MY~2004MY Legacy Vehicles  
**SUBJECT:** Sunshade for Rear Sunroof on  
 Dual Sunroof Models

**NUMBER:** 12-80-03  
**DATE:** 05/19/03

**INTRODUCTION**

In the event you need to replace the rear sunshade on a 2000~2004MY Legacy Wagon model, the following repair method should be used in lieu of removing the sunroof unit as advised in the current Service Manual. This new repair method is the only acceptable method under warranty. The sunshade replacement kit is composed of: one sunshade, two guide pieces, and two clips.

**PARTS INFORMATION**

<b>REPAIR KIT SHADE REAR WAG</b>	
Gray Roof	65409AE0000B
Beige Roof	65409AE000GF

**REPAIR PROCEDURES/INFORMATION:**

- 1) Pull the rear sunshade open and detach the plastic clips that hold up the track covers (fig. A).



**FIGURE A**

*Continued on next page...*




**CAUTION: VEHICLE SERVICING PERFORMED BY UNTRAINED PERSONS COULD RESULT IN SERIOUS INJURY TO THOSE PERSONS OR TO OTHERS.**

Subaru Service Bulletins are intended for use by professional technicians ONLY. They are written to inform those technicians of conditions that may occur in some vehicles, or to provide information that could assist in the proper servicing of the vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do the job correctly and safely. If a condition is described, DO NOT assume that this Service Bulletin applies to your vehicle, or that your vehicle will have that condition.




- 2) Remove the lid installation nuts (two on each side, fig. B) and then remove the shim and glass lid.

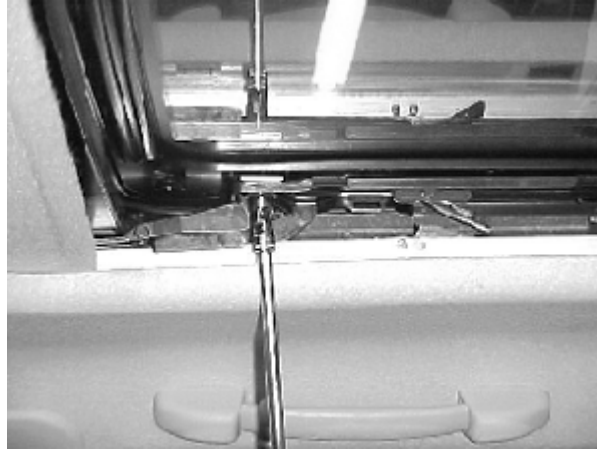

***FIGURE B***

- 3) Place protective tape around the sunroof opening to protect the paint from damage.
- 4) Remove the screw (fig. C) and the clip (fig. D) to free the arm.

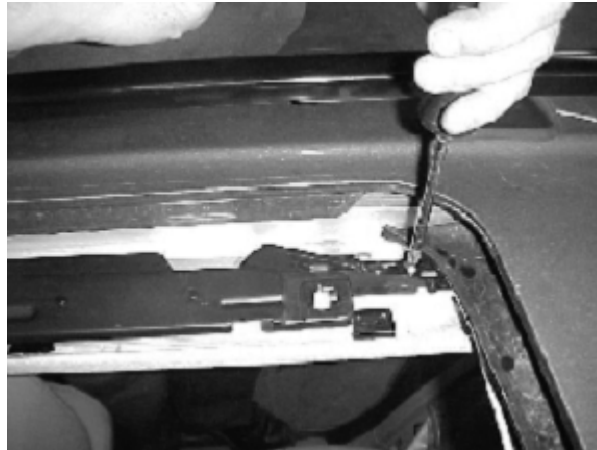


***FIGURE C***



***FIGURE D***

*Continued on next page...*

- 5) Remove the drain plate and guide (the guide is easily removed by pushing the part outward (fig. E)).

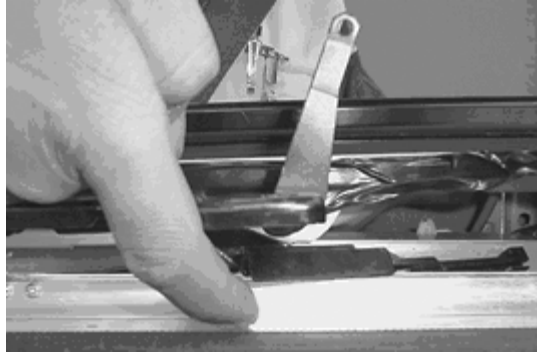

**FIGURE E**

- 6) Angle the arm parallel to the ground using a piece of tape (fig. F and fig. G).  
If the arm is not parallel it will interfere with other components when the sunroof is opened.




**FIGURE F**



**FIGURE G**

*Continued on next page...*

- 7) Pull the sunshade closed, then operate the sunroof to the full open position ensuring the sunshade stays closed.
- 8) Remove the plastic sheet springs (four on each side) from the sunshade frame by prying them with a small screwdriver (fig. H).

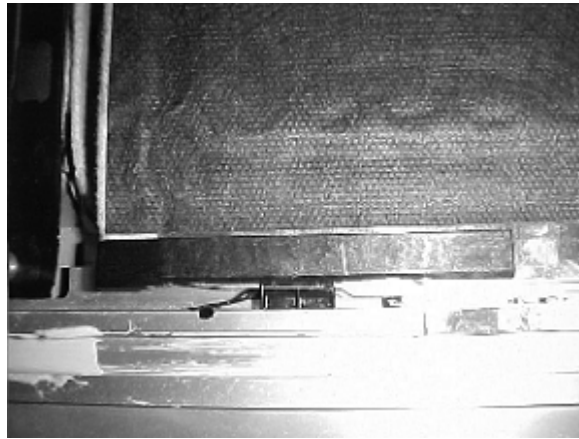

**FIGURE H**

- 9) Carefully remove the sunshade from the roof
- 10) Reinstall in the reverse order of removal and ensure proper operation of all components.

## **CLAIM REIMBURSEMENT/WARRANTY INFORMATION**

For vehicles within the Basic New Car Limited Warranty coverage period, this repair may be claimed using the following information:

<b>LABOR DESCRIPTION</b>	<b>LABOR OPERATION</b>	<b>LABOR TIME</b>	<b>FAIL CODE</b>
Sunshade for Rear Sunroof on Dual Sunroof Models	A 914 - 806	0.5 hours	XIZ – 03, 23, 29, 58, 70